AD-A031 897

ARMY AVIATION TEST BOARD FORT RUCKER ALA F/G 1/3 MODIFICATION OF THE TRANSMISSION OF THE UH-1B HELICOPTER EQUIPP--ETC(U) MAR 66

UNCLASSIFIED

NL

OF | AD31897
















END
DATE
FILMED
1 - 77

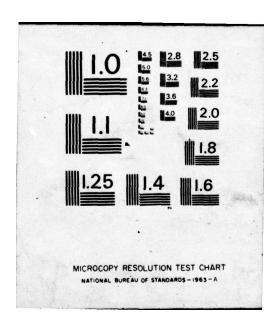

DEPARTMENT OF THE ARMY
UNITED STÄTES ARMY AVIATION TEST BOARD
Fort Rucker, Alabama 36360

B.

29MAR 166

STEBG-TD

SUBJECT: Feasi

Feasibility Study Modification of the Transmission of the UH-1B Helicopter Equipped with a 540-Rotor System for Use as a Universal Transmission for Standard UH-1B and UH-1D Helicopters USATECOM Project No. 4-4-0108-12 (AVN No. 02-66-03)

13/2·

TO:

Commanding General
US Army Materiel Command
ATTN: AMCPM-IR
Washington, D.C. 20315

1. Reference. Message, APG 3301, Commanding General, US Army Test and Evaluation Command, 1 March 1966, subject: "Universal Transmission, UH-1."

### 2. Background.

a. At the present time separate transmissions for the UH-1B, UH-1B/540, and UH-1D in the supply system. A need exists for the development of a common or universal transmission that can be easily adapted for use in the three helicopters.

Engineering Change Proposal (ECP) UH-1B/D-242 on 21 July 1965. The ECP incorporated a "nude" transmission concept and was developed for a transmission that had not entered the supply system. The Iroquois Project Manager initiated a study to determine the feasibility of using one of the three production UH-1 transmissions as the basis for a universal transmission. The Project Manager authorized the 10th Aviation Group, Fort Benning, Georgia, to modify a UH-1B/540 transmission for installation on a UH-1D and a UH-1B. The concept of modifying a UH-1B/540 transmission for use in standard UH-1B and UH-1D Helicopters proved worthy of further investigation. The Project Manager requested a detailed test of this concept be conducted. The Commanding General, USATECOM directed the US Army Aviation Test Board to conduct this test under USATECOM Project No. 4-4-0108-12.

Approved for public release; distribution unlimited.

NOV 11 1976

B A 036 500

Inel 32

STEBG-TD

SUBJECT: Feasibility Study, "Modification of the Transmission of the UH-1B Helicopter Equipped with a 540-Rotor System for Use as a Universal Transmission for Standard UH-1B and UH-1D Helicopters," USATECOM Project No. 4-4-0108-12 (AVN No. 02-66-03)

#### 3. Objectives.

a. Purpose. To determine the feasibility of modifying the transmission of the UH-1B Helicopter equipped with a Model 540 rotor system (UH-1B/540) to permit its use as a universal transmission for all UH-1B and UH-1D Helicopters.

#### b. Test Objectives.

- (1) To determine the procedures, active man-hours, and parts required to modify a UH-1B/540 transmission for installation in standard UH-1B and UH-1D Helicopters.
- (2) To determine variations from published installation instructions and, if variations exist, the active man-hours required to install the modified transmission.
- (3) To determine the categories of maintenance at which the modification and the installation of the universal transmission are to be performed.
- (4) To determine any variations in run-up and test flight procedures resulting from installation of the test transmission in the UH-1D and UH-1B Helicopters.
- 4. Scope of Test. The feasibility study was conducted at Fort Rucker, Alabama, from 25 February 1966 through 2 March 1966.
- a. The transmission used as the basic test item was a standard UH-1B/540 transmission. Its size and the positions of mounting points were measured to insure commonality with the standard UH-1B and UH-1D transmissions.
- b. The UH-1B/540 transmission was modified for use in the UH-1D Helicopter by adding or substituting components common to the UH-1D. The modified transmission was installed in the UH-1D Helicopter and a run-up and one-hour test flight was conducted.
- c. On the basis of determinations made from modifying the UH-1B/540 transmission to a UH-1D transmission configuration, qualified project personnel determined the functions necessary to modify the

STEBG-TD

SUBJECT:

Feasibility Study, "Modification of the Transmission of the UH-1B Helicopter Equipped with a 540-Rotor System for Use as a Universal Transmission for Standard UH-1B and UH-1D Helicopters," USATECOM Project No. 4-4-0108-12 (AVN No. 02-66-03)

UH-1B/540 transmission to a UH-1B transmission configuration. With the concurrence of the Iroquois Project Manager, the modified transmission was not installed or flight tested in the UH-1B Helicopter.

### 5. Summary of Results.

#### a. Man-Hours, Parts, and Procedures.

- (1) UH-1D. Two helicopter mechanics (MOS 67N20) required a total of four active man-hours to modify a UH-1B/540 transmission to a UH-1D configuration. Parts and procedures are listed in inclosures 1 and 2.
- (2) UH-1B. One helicopter mechanic (MOS 67N20) required 0.3 active man-hour to modify a UH-1B/540 transmission to a UH-1B configuration. No parts were required. The two wires on the tachometer generator had to be reversed.

#### b. Installation Instructions.

- (1) No variations from the procedures outlined in TM 55-1520-210-35 were required to install the modified UH-1B/540 transmission in UH-1D and UH-1B Helicopters.
- (2) Since UH-1B/540 transmission has two hydraulic pump mounting pads, the unused right hand pad must remain covered.
- c. Maintenance Categories. Modification and installation of the UH-1B/540 transmission required the direct-support category of maintenance.
- d. Run-Up and Test Flight Procedures. No variation from standard run-up and test flight procedures was required in the UH-1D.
- 7. Conclusion. Modifying the UH-1B/540 transmission to permit its use as a universal transmission for all UH-1B and UH-1D Helicopters is feasible.

2 Incl

Distribution: (See page 4)

YMOND E. JOHNSON Colonel, Artillery President

DISTRIBUTION AVAILABILITY COURS AVAIL and/or SPECIAL

White Section

000

BNANHOUNCED

JUSTINGATION

STEBG-TD

SUBJECT: Feasibility Study, "Modification of the Transmission of the UH-1B Helicopter Equipped with a 540-Rotor System for Use as a Universal Transmission for Standard UH-1B and UH-1D Helicopters," USATECOM Project No. 4-4-0108-12 (AVN No. 02-66-03)

Distribution: (continued)

Commanding General

2 copies

US Army Test and Evaluation Command ATTN: AMSTE-BG

Aberdeen Proving Ground, Maryland 21005

Commanding General US Army Materiel Command 2 copies

ATTN: AMCPM-IRFO St. Louis, Missouri 63166

# UH-1D Parts Required To Modify a UH-1B/540

## Transmission for Use in a UH-1D Helicopter

	Name and Federal Stock Number	Quantity
1.	Quill Assembly, Generator Offset FSN 1560-987-5152	1
2.	Bracket*, General Support FSN 1560-992-6471	1
3.	Spacer*, Sleeve FSN 5340-729-6675	3
4.	Spacer*, Sleeve FSN 5340-950-6477	1
5.	Bolt*, Machine FSN 5306-576-5635	4
6.	Shim* FSN 5340-989-2978	1
7.	Washer*, Flat FSN 5310-167-0821	8
8.	Washer*, Flat FSN 5310-187-2400	4
9.	Nut*, Extended Washer, Hex FSN 5310-807-1477	4
10.	Oil Filler Assembly:	
	a. Adapter FSN 1560-690-7294	1
	b. Filler Assembly, Neck and Scupper FSN 1560-961-1345	- 1
	c. Washer, Flat FSN 5310-187-2354	8
	d. Nut, Extended FSN 5310-807-1468	•

\*Parts required to install Quill Assembly, Generator Offset.

7	ame and Federal Stock Number	Quantity
•	. Elbow, Tube	1
	FSN 4730-722-7216	
f	. Nut, Plain, Hex	1
	FSN 5310-208-4112	
8	. Packing, Preformed	1
	FSN 5330-263-8030	
h	. Tube Assembly, Metal	1
	FSN 1560-992-6473	
i	. Cap Assembly, Transmission	1
	FSN 1560-992-6473	
C	il Hose Inlet	1
E	SN 4720-759-7303	

### Steps Required to Modify a UH-1B/540 Transmission

#### for Use in a UH-1D Helicopter

- 1. Remove Plate Assembly, FSN 1560-898-1684, from UH-1B transmission (figure 119, page 2-240, TM 1520-210-35P).
- 2. Install UH-1D Quill Assembly, Generator Offset (item 1, inclosure 1) using parts 2 through 9 of inclosure 1 (figure 123, page 2-430, TM 55-1520-210-35P).
- 3. Remove Oil Filter Assembly, FSN 1560-796-5004, from UH-1B/540 transmission (figure 156A, page 2-691, TM 55-1520-210-35P).
- 4. Install UH-1D Filler Assembly (items 10.a through 10.i, inclosure 1) (figure 117, page 2-415, TM 55-1520-210-35P).
- 5. Remove Oil Hose, Inlet, FSN 4702-758-0172, from UH-1B/540 transmission (figure 156A, page 2-691, TM 55-1520-210-35P).
- 6. Install UH-1D Oil Hose, Inlet (item 11, inclosure 1) (figure 7-6, page 7-12, TM 55-1520-210-20).
  - 7. Reverse the two wires on the tachometer generator.